

Subject: SBU Sensor Array Control Box Connector

Overview

Wrong Connector P2 used in production units, causing an intermittent connection.
Part #11000534

Problem

Connector P2 Retainer tab mates with the controller circuit board which cannot accommodate the retainer so it was bent back in order to be installed. The plastic tab eventually tries to return to its original shape and pushes the connector away from the board making the connection intermittent.

A small number of P2 connectors with the tabs were used. Corrections were done to the drawings and Rev. "C" was created to release Part #11000534 without the tabs.

Solution

If there are any installations with P2 Part # 11000534 with the Tab still attached, please remove (Cut Off) the Tab.

(TAB) Cut Off



INQUIRIES TO:

Fujitsu Transaction Solutions Inc.
Exchange: Sustaining Engineering
Mail: Fujitsu USA04, Sustaining Engineering
FAX: 858-731-4781 (7888-4781)
Internet: sustainingengineering@ftxs.fujitsu.com
FTP: <ftp://ftp.ftxs.fujitsu.com/>

Sustaining Engineering

Product Manager

Author

DATE

Original signature copies maintained by Sustaining Engineering.