

Subject: New MicroCoin QL3 Coin Acceptor - Canada

Overview

The Canadian Mint has updated the new \$1 & \$2 coins originally defined for release. To support this update MicroCoin has released an updated version of the FW for the QL3 coin acceptor to be used in the Genesis, NextGen, and LT U-Scan platforms.

Part Information

| Part Number | Description | Supersedes |
|-------------|--|----------------------|
| 11004171 | Coin Acceptor, MicroCoin QL3, Model Q5232-DO, Configuration CA812-M8, Canada | 11003204 11004113 |
| 11004172 | Coin Acceptor, MicroCoin QL3, Model Q5242-DO, Configuration CA012-M8, Canada | 11001345 11004133 |
| 11001204F3 | Coin Acceptor Field Kit for Genesis QL3 Model in NextGen & LT, Canada | N/A |

For Genesis U-Scan systems, use the 11004171 unit.

For NextGen and LT systems with MicroCoin QL1, QL2, & QL3 models there are two replacement options.

1. Replace only the MicroCoin unit using MicroCoin QL3 11004172.
2. Replace the MicroCoin unit and MoneyFlex interface with field kit 11001204F3. Reference PSB-08-064 for details of this conversion.

The field kit includes the following:

| | |
|----------|---|
| 11004171 | Genesis Coin Acceptor, MicroCoin QL3 |
| 11001354 | Cable Assy, CCTalk, MicroCoin QL3 |
| 11003000 | Cable Assy, Y-Type With DC Power Plug, .3M, DB9M to DB25F/M |

The following page contains the support status of all the Canadian coins.

| | | |
|---|---|-------|
| INQUIRIES TO: | | DATE |
| Fujitsu Frontech North America | | |
| Exchange: | Sustaining Engineering | _____ |
| Mail: | Fujitsu USA20, Sustaining Engineering | _____ |
| FAX: | (949) 458-6257 | _____ |
| Internet: | SustainingEngineering@us.fujitsu.com | _____ |
| FTP: | ftp://ftp.ftxs.fujitsu.com/Pos/PosSustaining/ | _____ |
| Original signature copies maintained by Sustaining Engineering. | | |



| Coin | Mint Date | Years Minted | Coin Compositions | Support Status |
|----------------|-------------|------------------------|---|------------------------|
| 1c Old | 2002 | 2002 | Cu - 50th Queens coronation anniversary commemorative | Never Supported |
| 1c Old | 1982 | 1982 to 1996 | Bronze | Support Removed |
| 1c | 1997 | 1997 to 2000 | Cu Plated Zinc | Supported |
| 1c New | 2001 | 2001 to present | Cu Plated Steel / Cu plated Zinc | Supported |
| 5c Old | 1955 | 1955 to 1981 | Nickel | Support Removed |
| 5c | 1982 | 1982 to 1999 | CuNi | Supported |
| 5c New | 2000 | 2000 to Present | Ni Plated Steel | Supported |
| 10c | 1968 | 1968 to 1999 | Nickel | Supported |
| 10c New | 2000 | 2000 to Present | Ni Plated Steel | Supported |
| 25c | 1968 | 1968 to 1999 | Nickel | Supported |
| 25c New | 2000 | 2000 to Present | Ni Plated Steel | Supported |
| \$1 | 1987 | 1987 to 2010 | Aureate Bronze plated Nickel | Supported |
| \$1 New | 2011 | 2011 to Present | | Support Added |
| \$2 | 1996 | 1996 to 2010 | Bi Metal | Supported |
| \$2 New | 2011 | 2011 to Present | | Support Added |

Impact

- Production All units manufactured/shipped after January, 2012 will have this change implemented.
- Installed Units Time to install, approximately 15 to 20 minutes.
- Repair Center N/A
- Service Spares Return existing inventory to supplier for upgrade.