

**Subject: Genesis USB HUB Bracket Mount Changes**

**Issue**

There have been some reports that on the Genesis USB HUB, the cable connectors that plug into it are getting stressed due to not enough room between the bracket and the brace. This was only in the first approx. 50-75 Genesis units built. Units after that have the Mounting Bracket mounted different.

**Solution**

For earlier units that have this close fit issue, a Flat Washer can be added to the USB HUB bracket. This allows the bracket to be adjusted forward about 3/4 of an inch which will relieve the stress on the cables and connectors.

<u>Part Number</u>	<u>Description</u>
USA0301119	M6.4x18mmx1.6mm Steel Metric Flat Washer Z/P RoHS Compliant


This is a fit on fail or next visit update only.  
350 of the above parts have been provided to Spares Logistics.

**Instructions**

1. Remove the USB HUB Bracket by removing the 2 Screws using a Short Phillips screw driver.
2. Re-install the bracket using the same screws with the new Washer (USA0301119).
3. Slide USB Bracket forward as much as possible and tighten screws.
4. Done.

The Illustration below shows USB Bracket all the way back.

The Illustration below shows the new washer and bracket mount slide forward 3/4", giving more room for cables.

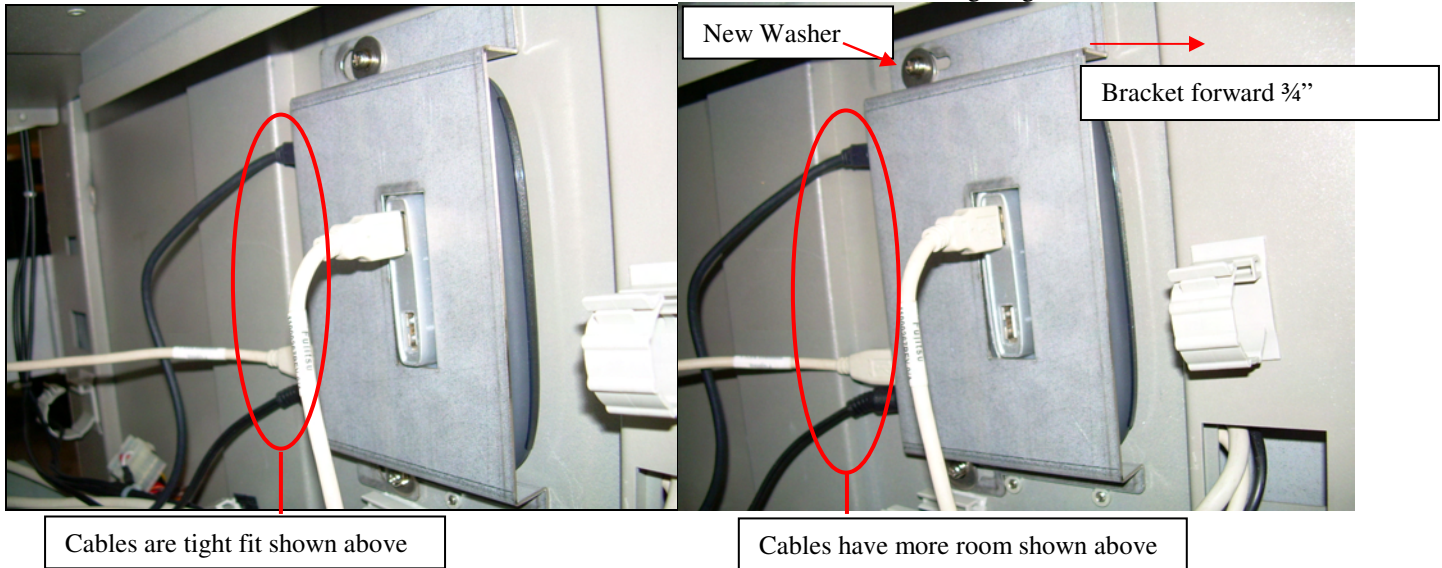

<u>INQUIRIES TO:</u>		DATE
Fujitsu Transaction Solutions Inc.	_____	_____
Exchange: Sustaining Engineering	Sustaining Engineering	_____
Mail: Fujitsu USA04, Sustaining Engineering	_____	_____
FAX: 858-731-4781 (7888-4781)	Product Manager	_____
Internet: <a href="mailto:SustainingEngineering@ftxs.fujitsu.com">SustainingEngineering@ftxs.fujitsu.com</a>	_____	_____
FTP: <a href="ftp://ftp.ftxs.fujitsu.com/">ftp://ftp.ftxs.fujitsu.com/</a>	Author	_____
Original signature copies maintained by Sustaining Engineering.		